



SAFETY COMPLIANCE & TRAINING LLC

Driver & Equipment Inspection

Location

Submitted By  [Santiago Talamantez](#)

Location was not collected for this report.

Submitted On	August 21 2019, 1:04pm
Weather	NaN°,
Version	V1 (latest)
Updated	August 21 2019, 1:04pm (15 minutes)
Report No.	9973522

Driver & Equipment Inspection

GENERAL DETAILS

Date	August 21st 2019
Division	Super Heaters - Trucking
Office Location	Killdeer, ND
Truck #	990
Trailer #	SH-30
Location Where Inspection Was Conducted:	Yard


DRIVER

Was the driver present during the inspection?	No
Permit Book (Cab Card, Insurance, Registration)	Unsatisfactory
Driver Inspection Notes	Permit book had several expired paperwork items.


EQUIPMENT

Lights / Reflectors / Reflective Sheeting	Unsatisfactory
Brakes / Slack Adjusters / Components	Unsatisfactory
Tires / Wheels / Hubs	Satisfactory
Exhaust / Steering Components	Satisfactory
Upper and Lower Couplers	Satisfactory
Windshield / Wipers / Washer Fluid	Satisfactory
Oil / Air Leaks	Satisfactory
Frame and Components	Satisfactory
Driveline / U-Joints	Satisfactory
License Plates	Satisfactory

Annual Inspections	Satisfactory
Load Securement	Unsatisfactory
Fire Extinguisher	Satisfactory
Triangles / Spare Fuses	Satisfactory
DOT Markings (US DOT #, Company, WHP, IFTA)	Satisfactory
Any other violations noted?	No

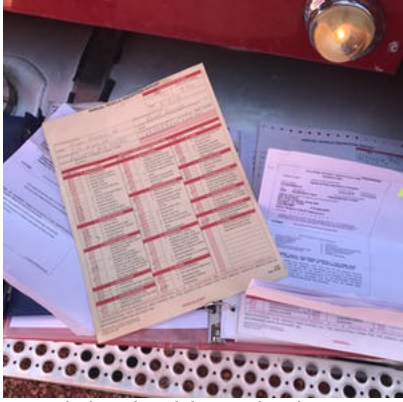

Permit book with expired paperwork.

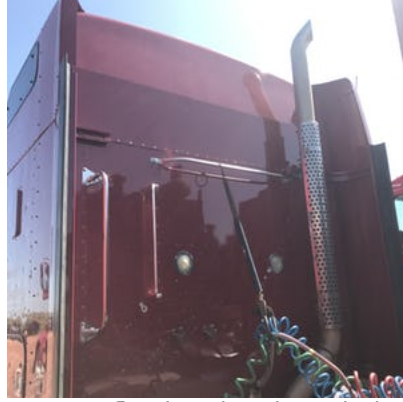

Upper reflective sheeting missing on back of cab (Requires 1' white vertical and horizontal strips in upside down L shape)



Axle 2 left shock loose (missing bushing)



Mud flaps missing red/white reflective sheeting.



Bungee cords used to strap down hoses.



ABS lamp inoperable when brakes applied.



Upper reflective sheeting missing



Plate lamp inoperable



Steering axle slack adjusters loose, have excess left to right movement. Possible blown seals.

SUMMARY

Person Conducting Inspection [Santiago Talamantez](#)

Generated Thursday, February 20th 2020, 4:49am CST

powered by  **iScout**