




## SAFETY COMPLIANCE & TRAINING LLC

### Driver & Equipment Inspection

### Location

Submitted By  [Santiago Talamantez](#)

*Location was not collected for this report.*

Submitted On	September 16 2019, 12:10pm
Weather	NaN°,
Version	V1 (latest)
Updated	September 16 2019, 12:10pm (4 hours)
Report No.	10147631

### Driver & Equipment Inspection

#### GENERAL DETAILS

Date	September 16th 2019
Division	<a href="#">Phoenix Lease Services</a>
Office Location	<a href="#">Big Spring, TX</a>
Location Where Inspection Was Conducted:	Yard

#### PERMIT BOOK

Truck #	756
Trailer #	9229
Registration Cards (Truck / Trailer)	Yes
Notes:	<i>None</i>
Insurance Card	Yes
Notes:	<i>None</i>
TXDMV / OCC Cab Card	Yes
Notes:	<i>None</i>
Annual Inspections (Truck / Trailer)	Yes
Notes:	<i>None</i>
Waste Hauler's Permit (TX) / Deleterious Substance Permit (OK)	Yes
Notes:	<i>None</i>

#### DRIVER

Was the driver present during the inspection? No

**Driver Inspection Notes** Overweight Permit expired 05/2019, need to check on renewal. Permit books are very organized and up to date.

**EQUIPMENT**

**Lights / Reflectors / Reflective Sheeting** Satisfactory

**Brakes / Slack Adjusters / Components** Satisfactory

**Tires / Wheels / Hubs** **Unsatisfactory**

**Exhaust / Steering Components** Satisfactory

**Upper and Lower Couplers** Satisfactory

**Windshield / Wipers / Washer Fluid** **Unsatisfactory**

**Oil / Air Leaks** **Unsatisfactory**

**Frame and Components** **Unsatisfactory**

**Driveline / U-Joints** Satisfactory

**License Plates** Satisfactory

**Annual Inspections** Satisfactory


**Load Securement** Satisfactory

**Fire Extinguisher** Satisfactory

**Triangles / Spare Fuses** Satisfactory

**DOT Markings (US DOT #, Company, WHP, IFTA)** Satisfactory

**Any other violations noted?** *None*

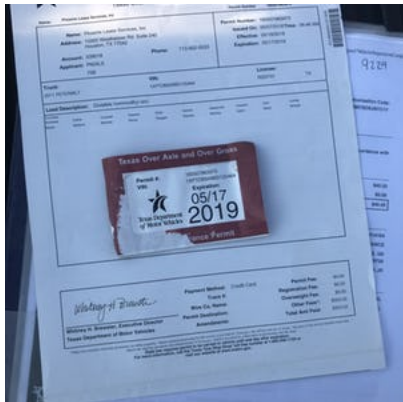

OS/OW expired, not a violation just need to check renewal.



PLS Big Spring has very presentable permit books.



Removed both expired 2018 IFTA decals.



Wrong color reflective sheeting on back of cab.



Axle 4 Left (front trailer axle) - Two loose wheel fasteners side by side OOS\*\*



Wrong color reflective sheeting upper rear area of trailer.



Axle 4 Right - Brake hose chafing (no splitter)



Axle 4 Right - Shock loose



Axle 4 Left - Shock loose (bushing worn)



Rear right mud flap dirty - reflective sheeting covered in dirt / mud ineffective appearance.



Electric line chafing on catwalk. Has worn grommet.



Hose chafing - Air ride suspension (two separate flat spots on service side)

**SUMMARY**

